

Reference	SSM75429
Models	Defender / L663
Title	New Defender L663 – Roof Opening Panel - Glass Inoperative, Sunblind loss of One Touch
Category	Body
Last modified	08-Jun-2021 00:00:00
Symptom	102000 Window/Glass

Content

Issue:

JLR is investigating Roof Opening Panel Inoperative/Loss of One Touch closure function

Cause:

Loss of calibration within the Roof Opening Panel motor assembly

Action:

Please complete the following steps:

- Start the engine and leave running during the initialization process
- Make sure that the roof opening panel blind/roof opening panel glass is in the fully closed position - press the close switch to achieve this
- Press and hold the close switch again and wait for the roof opening panel glass to jog forward a few millimetres and then return to its original position (this should take approximately 30 seconds), then release the switch
- Within 3 seconds, press and hold the close switch. The roof opening panel blind/roof opening panel glass will automatically travel toward the open position and then to the fully closed position. Release the switch when movement is complete

PLEASE NOTE – This communication will be superseded when Modified Opening Roof Panel Motor Service Parts are available. Please do not replace the Roof Opening Panel Motor Assy for this Concern.

Thank you in advance for your assistance with this matter.