

Rear Differential e-Diff - Knock Noise or Judder/Vibration	19MY Range Rover, RR Sport 20-23MY Land Rover Defender
<p><b>Customer Voice:</b></p> <ul style="list-style-type: none"><li>Customers will be reporting a knocking noise or judder/vibration, from the rear of the vehicle when turning the left or right during low speed.</li></ul> <p><b>Technical Description:</b></p> <ul style="list-style-type: none"><li>Differential fluid is contaminated</li></ul> <p><b>Status:</b></p> <ul style="list-style-type: none"><li>Remove the Rear Differential locking motor fuse and road test the car.</li><li>If the symptom is not present after the fuse removal and road test, then please carry out a double flush of the rear differential oil.</li><li>Perform the Double flush the oil in rear differential (TOPIx section 205-02)</li><li>Inspect the rear differential and rear subframe mounts</li><li>Please capture images/videos of the mounts as assembled, to support an ePQR with this SSM number as a reference within the customer concern field and quoting PTS_800.</li></ul> <p style="text-align: center;">Refer to SSM 75898</p>	