

TECHNICAL INFORMATION

Resistor Installation Needed for DRL Activation



No: 86/09/99/NAS

Ref:

Issue: 1

Date: 11/12/99

AFFECTED VEHICLE RANGE:

DISCOVERY Series II (LT)

From production start MY2000*

***Some vehicles built after MY2000 production start may have factory-fitted resistor.**

SITUATION:

HEADLIGHTS FLICKER AND BUZZ WHEN DRL FEATURE IS ACTIVATED

The DRL resistor has been deleted from the US build specification in the 2000 models. When the DRL feature is activated as a customer option on Discovery Series II vehicles without the resistor, the headlights will flicker in DRL mode, but not when the headlamp switch is turned on. In addition, a buzzing noise may be heard in DRL mode.