



# TECHNICAL ALERT

March 21, 2000

TA00 1202

NAS  US Only  Cda Only

**ATTENTION:** Service Manager Service Advisor Technician

## Inlet Valley End Clamps ERR7282

We have seen a dramatic increase in the use of Inlet Valley End Clamp (ERR7282).

These clamps are **reusable** components (Figure 1). The two clamps should be reused when performing inlet gasket installations on vehicles **after** the safe VINs listed below:


Range Rover .....WA379043

Discovery .....VA727032

Defender .....VA127670

**NOTE: Any unusual circumstances requiring the replacement of end clamps (ERR7282) after the safe VINs should be reported on an electronic Product Report.**

Vehicles manufactured **before** the above VINs should have a complete set of valley gasket components and bolts installed when a repair is performed

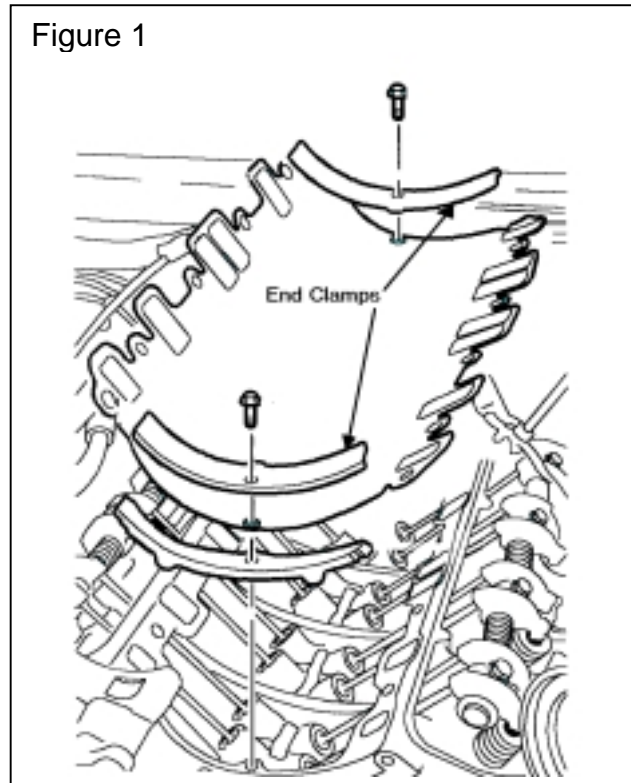

Please note the following part number information:

ERR7306 .....	Inlet Gasket	Qty 1
ERR7282 .....	End Clamp	Qty 2
ERR7283 .....	End Seal	Qty 2
LYG101440 .....	Short Bolt	Qty 10
LYG101450 .....	Long Bolt	Qty 2

A TIB will be issued shortly to further clarify the replacement and installation requirements of the valley gasket components