


ENGINE MANAGEMENT SYSTEM - SIEMENS

Engine Management System Component Location



M19 3417

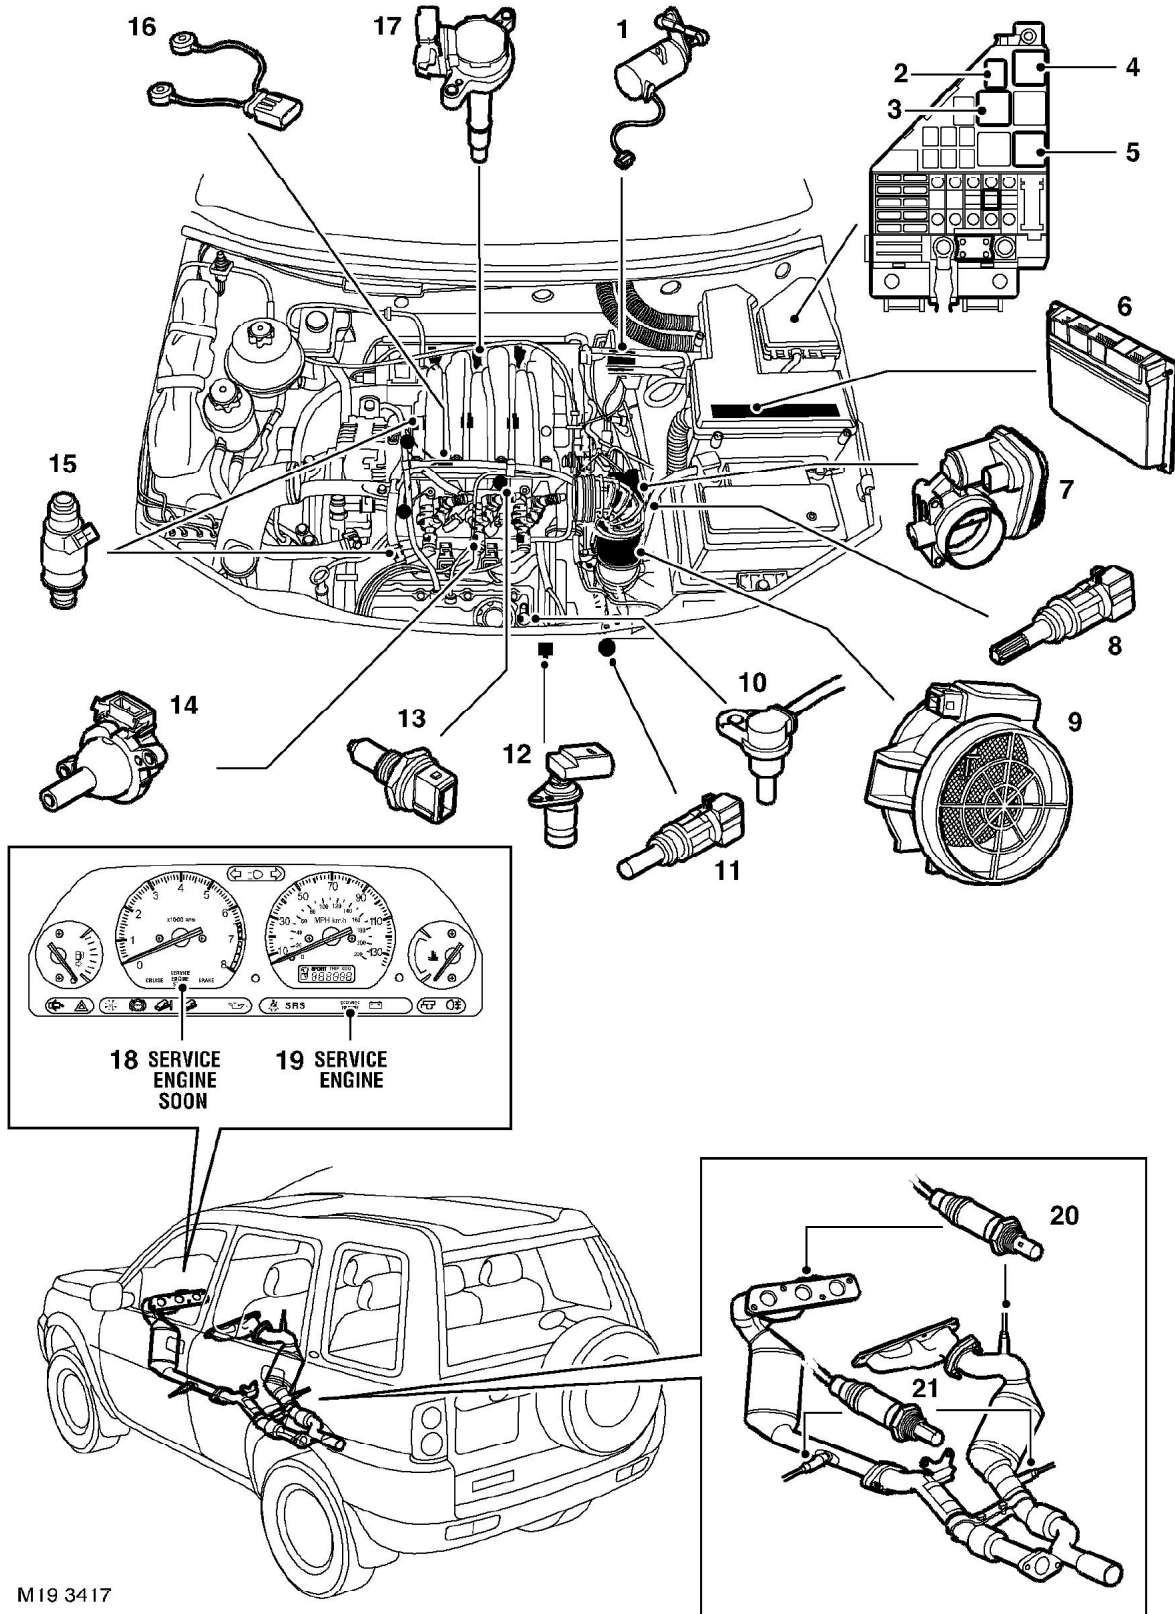

- 1 APP sensor (Up to 2003 model year shown)
- 2 A/C compressor clutch relay
- 3 Main relay
- 4 ECM relay
- 5 Fuel pump relay
- 6 ECM
- 7 Electric throttle
- 8 IAT sensor
- 9 MAF sensor
- 10 CMP sensor
- 11 Thermostat monitoring sensor
- 12 CKP sensor
- 13 ECT sensor
- 14 LH bank ignition coil (x 3) (Up to 2003 model year shown)
- 15 Fuel injector (x 6)
- 16 Knock sensors
- 17 RH bank ignition coil (x 3) (Up to 2003 model year shown)
- 18 MIL
- 19 Engine malfunction lamp
- 20 Front HO2S (x 2)
- 21 Rear HO2S (x 2)