



CIRCULATE TO:-		[REDACTED]	SUBJECT		12/31/96	
SERVICE MGR.	X		<b>PRIDE - Rear Brake Light/Rear Defogger Short</b>		86/13/96/US	
RECEPTION	X				MODEL  <b>Discovery</b> <b>Discovery</b>	AFFECTED VEHICLES LP LH LJ Up to VA542261 LJ Up to VA711170
WORKSHOP	X					
PARTS	X					

**DETAIL**


On some vehicles the rear defogger grid lead and the high mounted stop lamp lead may come in contact. This contact will blow fuse F1. If fuse F1 is blown, the shift interlock system locks the transmission when it is shifted into the Park position.

**ACTION REQUIRED**

Bend the brake light lead tab and the defogger lead tab 180° to avoid electrical contact.

**PARTS INFORMATION**

None

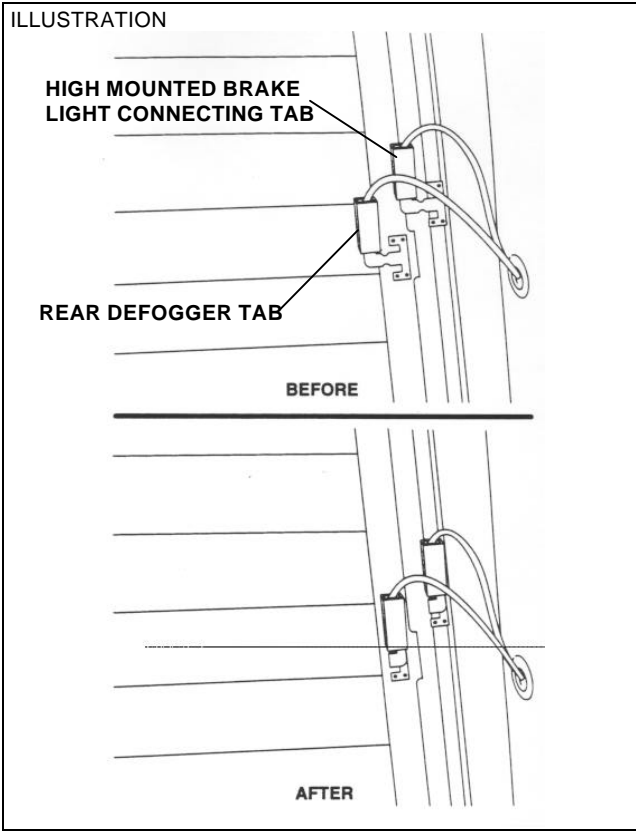

- PROCEDURE**
1. Locate the connector for the High Mounted Stop Light.
  2. Bend the vertical tab 180° to move it away from the rear defogger grid (see illustration opposite).
  3. In order to maintain a neat appearance, bend the rear defogger tab 180° also (see illustration).

**WARRANTY**  
Normal warranty policy and procedures apply

COMP. CODE

---

SRO  
86.41.89/26: Time 0.15 hr  
Reposition connectors