
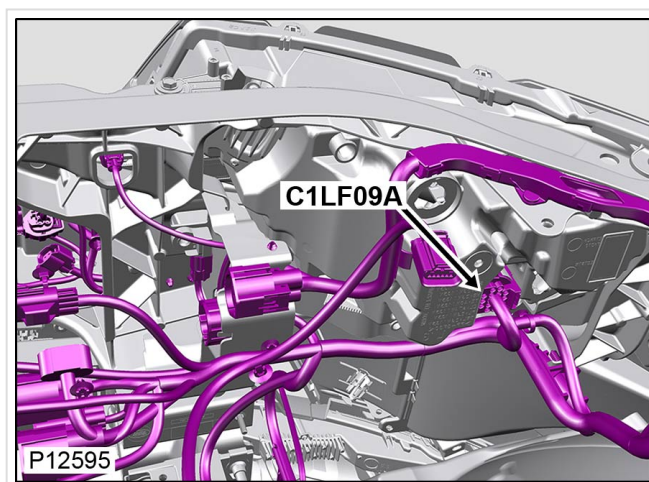


# C1LF09A : Headlamp-Right

## Connector Face

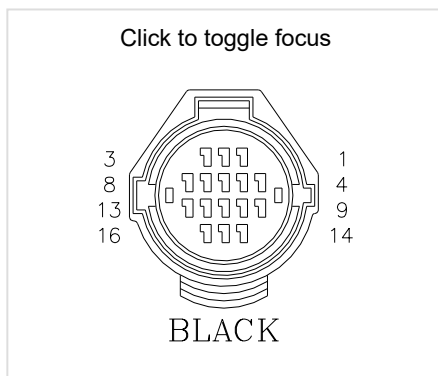

Connecto

C1LF09A

### Housing

Serviceable

### Engineering Part Number

6W8T-14A464-FA

### Service Part Number

YPC800820

### Colour

BLACK

### Cavities

16

### Harness

ENGINE COMPARTMENT LH  
HARNESS

### Description

Headlamp-Right

### Location

Front RH side of engine compartment

### Qualifier

LHD condition illustrated

## Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Wire Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.35	YE-VT	L462	C2BP01G	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
4	0.75	VT-OG	L462	C2BP01G	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
5	0.75	GN-BN	L462	SP12498	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
6	0.5	BK	L462	SP13129	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
7	0.5	VT-GN	JBBAB+DWABC	S1LF22A	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
7	0.35	VT-GN	(JBBBJ/JBBBG)+L462	S1LF66B	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
8	0.35	GN-WH	JBBAB+L462	C2BP01G	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
8	0.35	GN-WH	(JBBBJ/JBBBG)+L462	C2BP01H	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
9	1.0	BK	L462	SP13131	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated	Extract	Crimpers	Wire	Heat Shrink	Ident	Splice
					Lead	Tool		Stripper	Sleeve	Sleeve	
10	0.35	BU-GN	L462	C2BP01G	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
11	0.35	WH-VT	JBBAB+L462	C2BP01G	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
12	0.35	BK	L462	SP13131	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
14	0.35	BU-OG	JBBAB+L462	C2BP01G	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
16	0.5	BN-YE	(JBBBG/JBBBJ)+L462	S1LF09A	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107